Part Number: PT374-00210

Kit Contents

Item #	Quantity Reqd.	Description
1	1	Prism HomeLink® Mirror
2	1	Hardware Bag

Hardware Bag Contents

Item #	Quantity Reqd.	Description
1	1	English Operation Instruction Card
2	1	French Operation Instruction Card
3	1	Spanish Operation Instruction Card

Additional Items Required For Installation

Item #	Quantity Reqd.	Description
1		
2		
3		

Conflicts

Various MY19 and newer vehicles without OE EC Mirror

Recommended Tools

Personal & Vehicle Protection	Notes
Blankets, Towels	
Special Tools	Notes
None	
Installation Tools	Notes
Ratchet	
Torx Head Driver	T20
Nylon Panel Removal Tool	e.g. Panel Pry Tool #1 Toyota SST#00002-06001- 01
Torque Wrench	Reference TIS for value
Special Chemicals	Notes
Cleaner	VDC approved

General Applicability

Various MY19 and newer vehicles

Recommended Sequence of Application


Item #	Accessory	
1	Prism HomeLink® Mirror	
2		

*Mandatory

Vehicle Service Parts (may be required for reassembly)

Item #	Quantity Reqd.	Description
1		
2		
3		

Legend

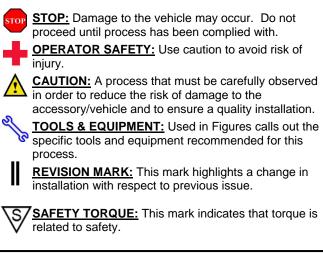




Care must be taken when installing this accessory to ensure damage does not occur to the vehicle. The installation of this accessory should follow approved guidelines to ensure a quality installation.


These guidelines can be found in the "Accessory Installation Practices" document.


This document covers such items as:-

- Vehicle Protection (use of covers and blankets, cleaning chemicals, etc.). •
- Safety (eye protection, rechecking torque procedure, etc.).
- Vehicle Disassembly/Reassembly (panel removal, part storage, etc.). •
- Electrical Component Disassembly/Reassembly (battery disconnection, connector removal, etc.). •

Please see your Toyota dealer for a copy of this document.

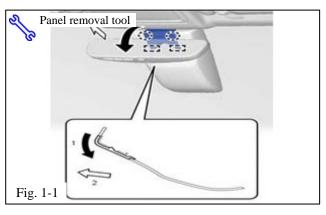

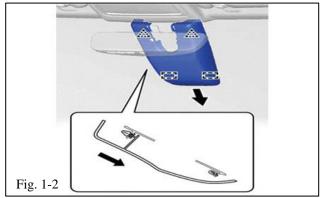

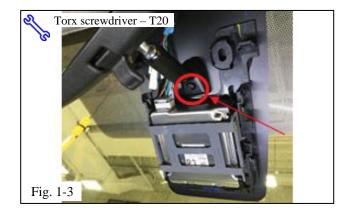

1. Vehicle Disassembly

- (a) Remove No. 2 Forward Recognition Cover (Fig. 1-1).
 - (1) Detach the 2 claws and 2 guides and remove the No. 2 forward recognition cover.




NOTE: If these claws are detached separately, they may break. Detach the claws simultaneously.

- (b) Remove No. 1 Forward Recognition Cover.
 - (1) Detach the 2 claws and 2 guides and remove the No. 1 forward recognition cover (Fig. 1-2).

NOTE: Push the cover while keeping it parallel with the surface of the glass so as not to damage the clips and guides.

- (c) Remove and discard the inner rear-view mirror.
- (d) Using a T20 "TORX", loosen the screw and remove inner rear-view mirror (Fig. 1-3).

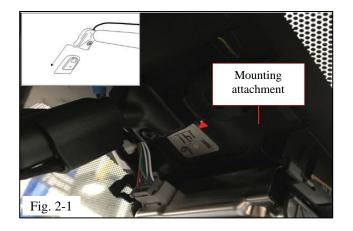

2. EC Mirror Installation


- (a) Install Prism HomeLink® Mirror (Fig. 2-1).
 - (1) Slide the Prism HomeLink® Mirror onto the mounting attachment on windshield.
 - (2) Using a T20 "TORX" torque wrench, tighten the Torx screw to 1.75 N-m (15.5 lbf.in).


Torque: 1.75 N-m (15.5 lbf.in)


3. Vehicle Assembly


- (a) Install No. 1 forward recognition cover.
 - (1) Attach the 2 clips and 2 guides to install the No. 1 forward recognition cover (Fig. 3-1).

- (b) Install the No. 2 forward recognition cover.
 - (1) Attach the 2 guides and 2 claws to install the No. 2 forward recognition cover (Fig. 3-2).

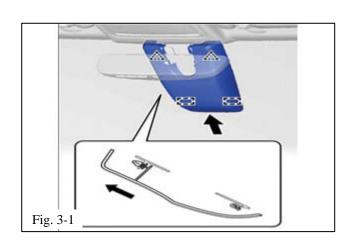

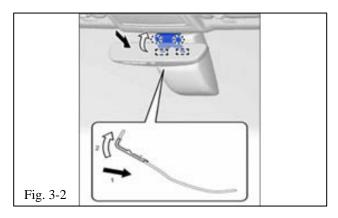

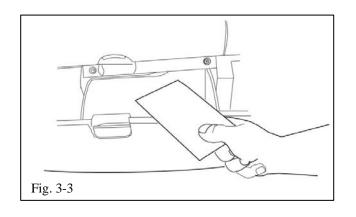

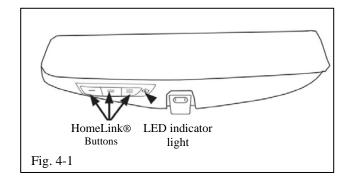

(c) Place Prism HomeLink® mirror operation instructions card into the vehicle glove box (Fig. 3-3).

4. Functional Check

- (a) HomeLink® Feature:
 - (1) Push in HomeLink® buttons one at a time.
 - (2) Verify the LED indicator light is blinking amber when each switch is pushed (Fig. 4-1).

NOTE: The owner of the vehicle will need to program HomeLink®. See the HomeLink® programming instructions on the operation instructions card.

TOYOTA VARIOUS MODELS 2019 -

PRISM HOMELINK MIRROR

Checklist - these points **MUST** be checked to ensure a quality installation.

Check:	Look For:
Accessory Function Checks	
HomeLink® push buttons verification	Verify LED indicator is flashing amber.
Operation instruction card	Placed in the vehicle glove box.
Vehicle Function Checks	
Vehicle Appearance Check	
After accessory installation and removal of protective cover(s), perform a visual	Ensure no damage (including scuffs and scratches) was caused during the
inspection.	installation process.
	(For PPO installations, refer to TMS
	Accessory Quality Shipping Standard.)